DRAW WIRE SENSOR USER MANUAL

AWP 110

GENERAL INFORMATION

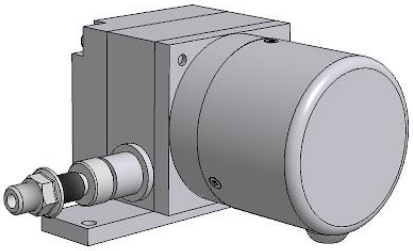

AWP 110 series draw wire sensors; consists of a rotary potentiometer which is controled by stainless steel wire. They make measurement by pulling and rewinding stainless steel wire.

Different measuring lengths from 100 mm to 1200 mm are available. They converts linear motion to potentiometric output.

The “A” series, works with 24VDC supply and gives of 4-20 mA analog output with the help of the converter card.

The “V” series, works with 24VDC supply and gives of 0-10 VDC analog output with the help of the converter card.

Optionally, different non-standard measuring lengths, cable length or socket model can be requested.

WARNINGS

- The installation of the product is carried out by the customer who purchases the product, according to the wiring diagrams, installation information, etc. in this manual.
- Maintenance and repair should be done by the technicians authorized by the manufacturer firm.
- There must be minimum distance between the sensor and control unit. Avoid additions except the suitable connector unless it needs.
- Keep away the sensor cable from as high power energy cables, contactor, motor, switched power supplies, inductive and capacitive noisy supplies.
- Shielding edge of the sensor cable must be ground connected.
- Not to damage the sensor, supply directions and voltage must be paid attention. Don’t energize before all connections completed.
- Transport and storage should be at their original packaging and an ambient temperature of -25°C / + 85°C in such a way that they will not be exposed to dust, humudity, impact, vibration, falling or water.
- Chemicals such as alcohol, thinner etc. should not be used for cleaning the product. The product should be wiped with a damp cloth.
- The product may be damaged and may become unusable if used outside of the specifications in the user manual.
- The product will be out of warranty if used outside of the specifications in the user manual and opened or repaired other than authorized services.

ELECTRICAL CONNECTIONS

Never make or undo electrical connections to the sensor when voltage is applied, otherwise this may result in damage to devices.

4-20 mA Connection		
Signal	**Cable Color**	**M12 5 pin male socket**
Earth	Silver	Pin 1
+V	Red	Pin 2
-	-	Pin 3
4-20 mA	Yellow	Pin 4
-	-	Pin 5

M12 5 Pin Male Socket

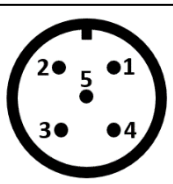

0-10V or POTENTIOMETER Connection		
Signal	**Cable Color**	**M12 5 pin male socket**
Earth	Silver	Pin 1
+V	Red	Pin 2
0V	Black	Pin 3
0-10V / Pot	Yellow	Pin 4
-	-	Pin 5

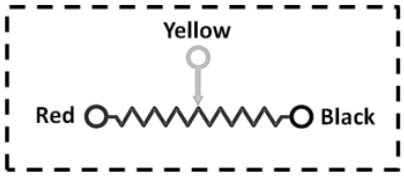

MECHANICAL MOUNTING

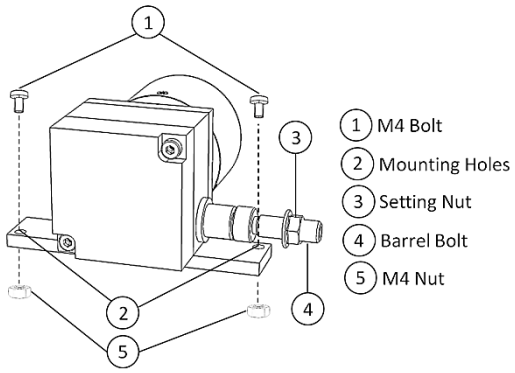

1- The product should be mounted to the relevant area with 2 units M4 bolts(1) and nuts(5) from the mounting holes (2) according to the mounting directions shown on page 3.

2- The sensor wire should be pulled towards the position to be connected with the barrel bolt (4).

3- The sensor wire should be mounted on the device to be connected by using the setting nut (3).

DIMENSIONS

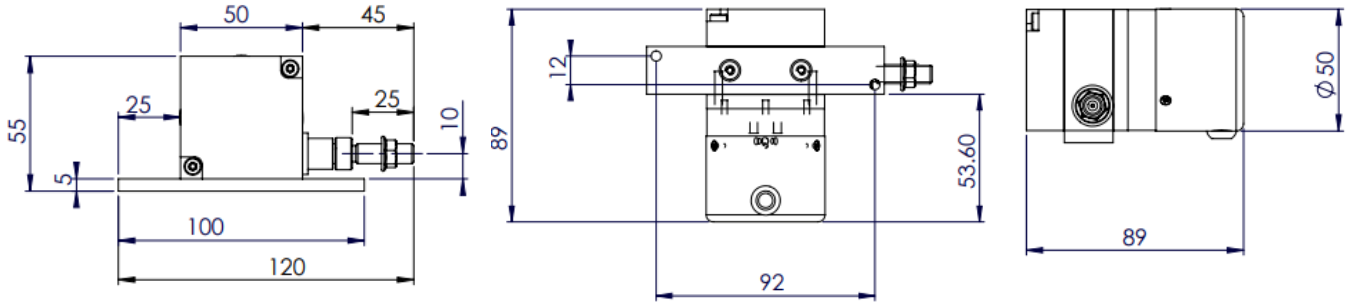

TECHNICAL SPECIFICATIONS

***Stroke (measuring) length**	Different measuring lengths from 100 mm to 1200 mm	**Required Force**	5 N
Linearity	±0.25% FS	**Operating Temperature**	-25°C … +85°C
***Supply Voltage**	'A' and 'V' models: 12…30 VDC		
	Potentiometric output model: 42V max.	**Relative Humidity**	%95
***Signal Output Type**	Potentiometric 0-10 VDC 4-20 mA	**Materials**	Housing: Aluminum/steel / plastic
			Measuring Wire: Stainless steel
Measuring Type	Potentiometric	***Connection cable length**	3m (standard), 5m, 10m
***Resistance**	5 KΩ (standard), 10 KΩ	**IP Protection Class**	IP53
Maximum Speed	2 m/s	**Weight**	≈550 gr

Note: The technical specifications indicated by (*) vary according to the selected model. The detailed code table is shown on page 4.

MOUNTING AND USAGE WARNINGS

1. Never release the wire after pulling. Otherwise, the coil spring will be damaged.

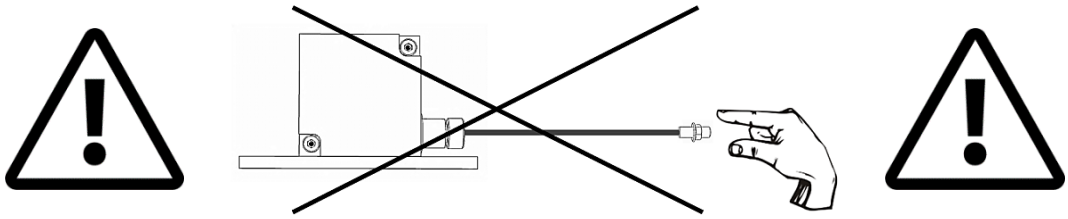

2. The wire sensor must be mounted vertically in position, not be horizontally.

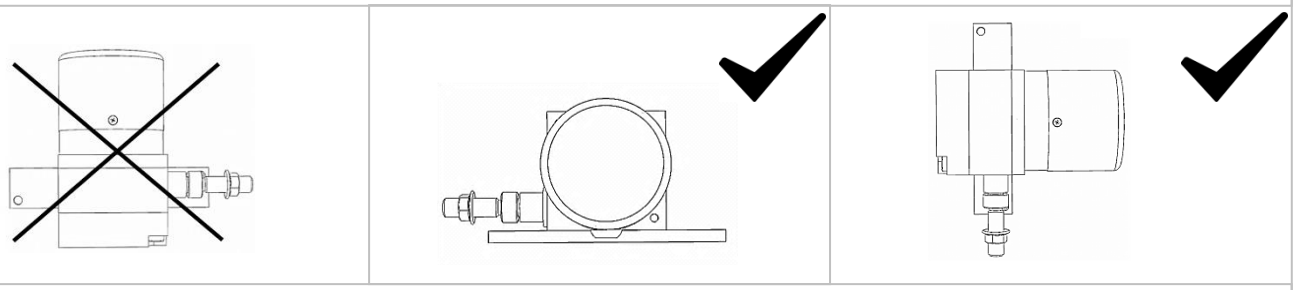

3. If there is a trickle of water (like a rain), the wire outlet must not be a drip of water upstream. If needed please use guide rollers.

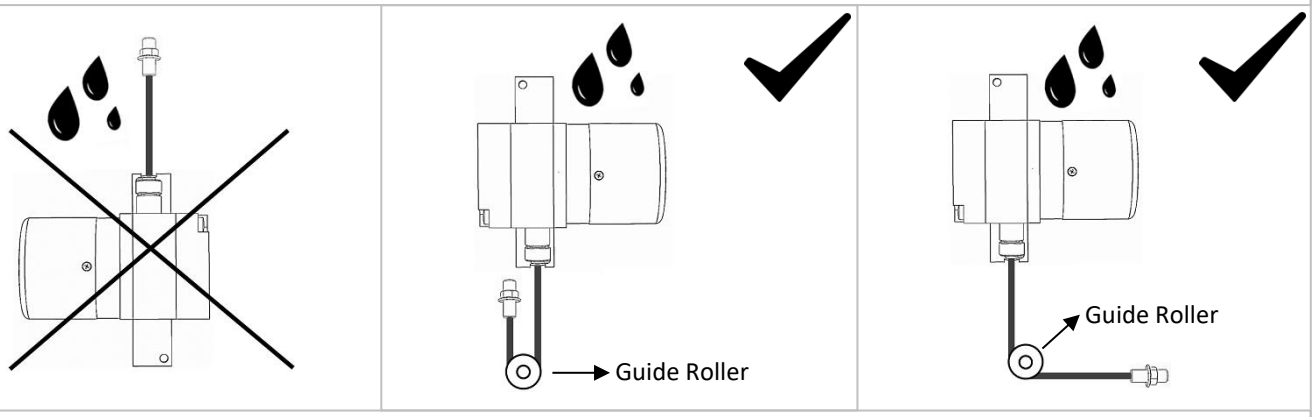

4. The wire should not be pulled in angular. If needed, please use guide rollers.

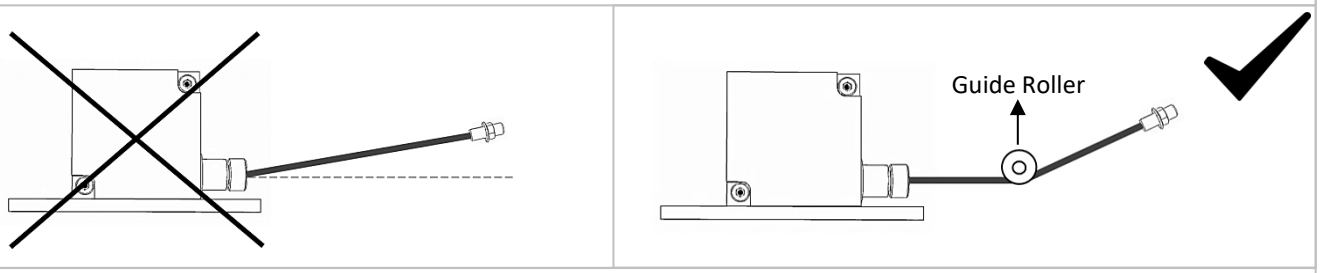

Important Note(!): Failure to comply with these recommendations, the malfunctions that may occur will not be under the warranty.

BOX CONTENTS

Product	Description
AWP 110	Draw Wire Sensor
Mounting Equipment	2 pcs. M4 bolts and nuts
User Manual	1 pcs.

PRODUCT CODE TABLE

Model

AWP 110

Resistance (2)

5K: 5 KΩ (standard)
10K: 10 KΩ

Output Signals

No Code : Potentiometric
V : 0-10 VDC
A : 4-20 mA

AWP 110	–	XXX	–	XX	–	X	–	XX

Stroke Length (1)

Different measuring lengths
from 100 mm to 1200 mm

Electrical Connection(3)

3M : 3 m
5M : 5 m
10M : 10 m
S13 : M12 5 pin male socket

(1) For other (special production) stroke lengths, please contact us.
(2) For other resistance options, please contact us.
(3) Please contact us for other cable length and socket model requests.

Sample Code 1: AWP-110-300-5K-S13-A
Explanation: AWP 110 series, 300 mm stroke, 5K resistance, 1 pcs M12 5 pin male socket, current output

Manufacturer Firm's Title, Address Details
Manufacturer Firm: ATEK ELEKTRONİK SENSÖR TEKNOLOJİLERİ SANAYİ VE TİCARET A.Ş.
Address: Gebze OSB, 800. Sokak, No:814 Gebze/KOCAELİ/TURKEY
TEL: +90 262 673 76 00 **FAX:** +90 262 673 76 08
Web: www.ateksensor.com **E-mail:** info@ateksensor.com

Authorized Service's Title, Address Details
Authorized Service: ATEK ELEKTRONİK SENSÖR TEKNOLOJİLERİ SANAYİ VE TİCARET A.Ş.
Address: Gebze OSB, 800. Sokak, No:814, Gebze/KOCAELİ/TURKEY
TEL: +90 262 673 76 00 **FAX:** +90 262 673 76 08
Web: www.ateksensor.com **E-mail:** info@ateksensor.com

Disposal of Packagings: Packaging materials consist of recyclable materials. For providing recycling, please dispose waste packagings to collecting points of authorized recycling facilities.
Disposal of E-Waste: This device is in conformity with WEEE Directive and consists of recyclable materials. This product should not be disposed with general waste for preventing negative effects on enviroment and human health. This product should be disposed to collecting points of authorized recycling facilities. Further information can be reached from authorized unit.

DISTRIBUTOR / DISTRIBUIDOR

Brazil and South America / Brasil e América do Sul

www.metrolog.net

Metrolog Controles de Medição

Address / Endereço:

Rua Sete de Setembro, 2656
13560-181 - São Carlos - SP
Brazil / Brasil

Phone / Telefone:

+55 (16) 3371-0112
+55 (16) 3372-7800

Internet:

www.metrolog.net
metrolog@metrolog.net