

THE FOLLOWING PAGE CONTAINS THE CONNECTION DETAILS

It is your responsibility to ensure that the transducer identification matches the connection details, including any RDP modification (T.M) references.

Please ensure that the transducer has not been modified or fitted with a cable or extension.


Particularly on DC-DC powered transducers, incorrect connection may cause **IRREPERABLE DAMAGE** to the transducer which is **NOT COVERED BY WARRANTY**

IF YOU ARE IN ANY DOUBT PLEASE CONTACT US



DCW SERIES TM321A & B

(CABLE OPTIONS 2, 3, 4, 5, 8, 10 & 11)

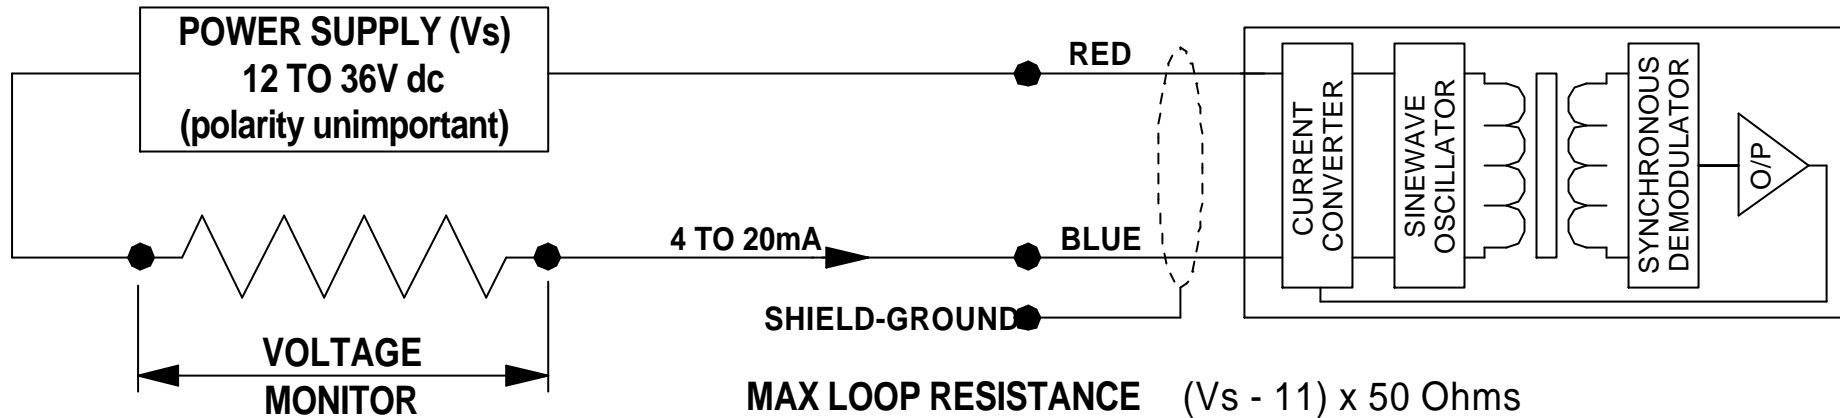

MAX LOOP RESISTANCE $(V_s - 11) \times 50$ Ohms
(Including monitor and cable resistance)

BANDWIDTH 250Hz (flat)

NOISE 50uA peak to peak max


ZERO TEMPCO 0.01% F.S./°C (Typical)

SPAN TEMPCO 0.03% F.S./°C (Typical)

OPERATING TEMP -10°C to +70°C

CALIBRATION 24V dc (see calibration certificate)

SUPPLY Smooth d.c. voltage 12 to 36V

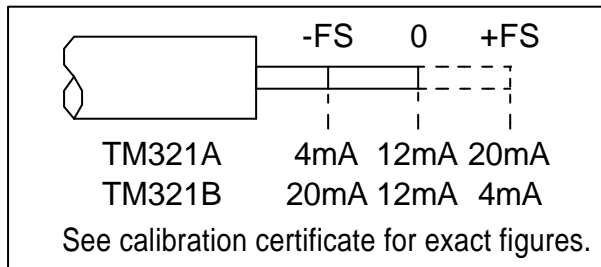

NOTE : INCORRECT CONNECTION MAY CAUSE IRREPARABLE DAMAGE
CONTACT OUR SALES DEPARTMENT IF YOU REQUIRE ASSISTANCE

RDP U.K.
Tel 01902 457512
Fax 01902 452000



Certificate No. FM 13141
BS EN ISO 9001:2000

MADE IN THE UNITED KINGDOM

Doc. Ref. WDUK1455
ISSUE 4 - 21 APR 2004

RDP U.S.A.
Tel 610 469 0850
Fax 610 469 0852

Distribuidor

Brasil e América do Sul

CONTATO

Endereço

Rua Sete de Setembro, 2656 - Centro
13560-181 - São Carlos - SP - Brasil

Telefone

+ 55 (16) 3371-0112
+ 55 (16) 3372-7800

Internet

www.metrolog.net
metrolog@metrolog.net

